

Mastersizer 3000 software v3.87 (PSS0223-35)

Software update notification





Contents

Introduction	3
Installation	3
Recommended system requirements	3
Supported languages	4
Installation instructions	4
Installing the Malvern Access Configurator (MAC) application	4
Uninstall procedure	4
Software categorization	5
GAMP 5	5
USP<1058>	
Validation support documents	5
Software license files	5
Sharing a license for Mastersizer 3000 users	
Sharing a license for Mastersizer 3000E users	6
Software guides	6
New features and fixed issues	7
New feature(s)	7
Fixed issues	
Security advisories	7
File types and locations	7
Changing the destination path for a file	9
Backup and restore files	10
What to backup	10
Restoring your files to the original PC hardware	10
Restoring your files to a new PC	10
Smart Instrument	10
Windows security settings	10
Changing the folder security permissions in Windows 10 & 11	11
Recommended PC power settings	14
Upgrading from an earlier version of software	
Measurement file format	
Audit trail upgrade	
Measurement file size and corruption warnings	
Backward compatibility with Mastersizer 2000	
Known issues	
Service & Support	21
oc. voc o opportunition and the second of th	



Introduction

This document details the release of software PSS0223-35: version 3.87 of the software for the Mastersizer 3000 and Mastersizer 3000E laser diffraction systems. It covers new features, bug fixes, know issues and lots of other helpful information to help you install and administer the application software.

The information within this document may also be required to perform a risk analysis to determine if the software should be installed. In this risk analysis the benefits of the resolved software issues must be weighed against the risk of new issues that may be introduced to vital areas of the software or possible changes to the results of future analysis. Installation instructions are provided. Data collection and analysis are unlikely to be affected following software upgrade.

Software release version upgrades often contains important security and compliance fixes. As such, we strongly recommend that you upgrade to the most version of the software at your earliest convenience.

Note: Please check for any updates to this Software Update Notification at

www.malvernpanalytical.com/en/support/product-support/mastersizer-range/mastersizer-3000

Installation

It is assumed that you have authority to install or update software within your facility. It is also assumed that you have Administrator rights for the system upon which the software is installed, as this is a requirement of the installation process. If you do not have this authority, please consult with your I.T. support department before proceeding.

Recommended system requirements

The recommended system requirements for running this software are highlighted in Table 1 below. Nevertheless, we fully expect the new software version to work on PCs with lesser or more advanced specifications. Software version 3.87 was fully tested using the recommended PC specification running Windows 10 version 20H2.

The software has not been fully tested on Windows 11 and although we do not anticipate problems, we recommend postponing the update to Windows 11 until we have completed our validation performance testing and informed you accordingly.

Specification Feature **Processor Type** Intel Core i7 Processor (8th generation or higher) Memory 16GB 250GB SSD Storage Connectivity 1 USB 2.0 or USB3.0 port **Operating System** Windows 10 Enterprise (64 bit - Pro and Enterprise) * * Preferred Operating System Power settings High performance (see details of advanced settings in the Known Issues section)

Table 1: Recommended system requirements for the Mastersizer 3000 v3.87 software.



Supported languages

The Mastersizer 3000 software currently supports operation in the following languages:

- English
- French
- German
- Japanese
- Chinese (simplified)
- Russian
- Polish
- Spanish

The language used by the application is automatically configured based on the operating system settings. If you want to force the application to use English instead of the operating system language, you need to start the application using the **Mastersizer 3000 (English)** start menu shortcut.

Installation instructions

If you are installing the software from a web download / USB drive, then browse to the folder where the files have been extracted to and then launch the \Mastersizer 3000\setup.exe program. Software version 3.87 contains no firmware changes over software version 3.84.

Note: It is important to initially install the software onto the PC without the Mastersizer 3000 being connected. Following download the PC should be powered down and the Mastersizer 3000 optical bench connected to the PC prior to powering up. Finally, the Mastersizer 3000 wet and / or dry dispersion accessories should be connected to the optical bench which is already attached to the PC and the PC then powered up. This will ensure that the instrument drivers are enabled, and that any firmware updates associated with this release are correctly downloaded to the instrument.

Note: Any firmware updates required for your system will be installed at the same time as the software. It is important to keep the firmware and software 'in sync', since this is the configuration that will have been tested by Malvern Panalytical prior to release of the software.

Installing the Malvern Access Configurator (MAC) application

The software suite includes a copy of the Malvern Access Configurator tool that allows you to manage the security aspects of the Mastersizer 3000 / 3000E. The MAC software may be installed either on the computer used to control the instrument or a separate networked computer. Installing on a separate computer allows you to manage the security centrally.

Note: The MAC software does not auto-install. To install this software, navigate to the \Malvern Access Configurator folder and run the setup.exe file.

As with all Windows applications, the MAC software must be installed by a user who is an administrator on the host computer. In addition, the MAC software uses the existing Microsoft Windows users and groups configured on the host computer to control access to the Mastersizer 3000 application. As such, prior to installing the MAC, it is important to ensure that the computer running the Malvern software is installed on its host network. If the computer is a stand-alone system, the required users and groups must be configured on the computer prior to the use of the MAC.

Given the above requirements, it is advised that a user's local IT department should review the requirements for use of the MAC application. An IT representation should also be present during the software installation process.

Note: Please read the Mastersizer 3000 software 21 CFR Part 11 user guide technical note (TN130801Ms300021CFRuserGuide) for more information as to how to use the MAC application, particularly when operation is required in a 21CFR Part 11 compliant environment. Note that operation in 21CFR Part 11 mode is not available for Mastersizer 3000E users.

Uninstall procedure

Version 3.82 (or lower) of the software can be uninstalled using the standard Add/Remove Programs feature in the Windows Control Panel.

For v3.82 (or higher) of the software a new set of Windows® Drivers were created. These drivers are not compatible with earlier versions of the Mastersizer 3000 software (v3.81 and earlier). If for any reason a customer wishes to downgrade to a software version earlier than v3.82, they should contact their local service support team for assistance.



Caution!



Downgrading v3.82, or higher, with 21CFR11 mode enabled to earlier versions of the software will cause this functionality to be switched off. 21CFR11 functionality can then be re-enabled once the downgrade is complete by re-enabling the Features File (navigate to the Options pages and select "Enable Auditing" and "Enable Electronic Signatures" from the 21 CFR Part 11 tab and "Enable Access Control" from the Access Control tab).

We recommend the MAC software is uninstalled in this way before updating to later versions (or even downgrading to earlier versions).

Software categorization

GAMP 5

The GAMP 5 guide provides guidance to pharmaceutical companies wishing to understand whether the computerized systems and software they used are fit for purpose and meet current regulatory requirements. As part of this, the GAMP committee has defined a series of software categories which are designed to help users in assessing the risk and validation requirements associated with using a specific software package.

In its standard mode of operation, the Mastersizer 3000 software provides users with a series of standard interfaces and functions that enable the software to be configured to meet specific user business requirements. These interfaces include the ability to define Standard Operating Procedures (SOPs) for sample measurement, create report definitions using pre-defined functions and develop data export templates using pre-defined parameters. If users apply these functions, then the software can be considered to be a Category 4 product.

In addition to the standard functions, the Mastersizer 3000 software provides users with the ability to modify the results reported by the system to fit their application requirements. This is achieved using the custom calculation reporting functions. These functions are not widely applied within regulated environments. However, if they are used to meet business requirements then the macros included within the custom calculations should be validated according to GAMP Category 5 requirements. Users are therefore encouraged to specifically validate any custom calculations applied within their reports and ensure these are documented. Where possible, we would encourage the use of the standard result reporting features, as this minimizes the risk of errors in the reported size distribution statistics.

USP<1058>

USP<1058> provides pharmaceutical users with guidance as to how the qualification of analytical systems should be carried out. As part of this guidance, the USP define a series of instrument categories. These instrument categories different from those described in GAMP 5, although the principles applied as part of the classification of a system are similar.

The Mastersizer 3000 is a computerized analytical system where the software provides users with the functions required to meet specific analytical application requirements. As such, it is a <u>Group C</u> instrument. Users are therefore recommended to define their requirements for the operation of the system and then compare these requirements to the claimed capabilities of the software and hardware. This should include an assessment of whether the new features and bug fixes included in a specific version of the Mastersizer 3000 software are necessary to meet business requirements.

Validation support documents

For Validation Support Documents, please refer to the Mastersizer 3000 Product Support section on the Malvern Panalytical website.

https://www.malvernpanalytical.com/en/support/product-support/mastersizer-range/mastersizer-3000

Software license files

The Mastersizer 3000 software requires a valid license file to run. When connected to an instrument, the system automatically generates this file, and the user will be asked to accept the license.

Note: If you wish to install the Mastersizer 3000 software on additional computers, you will need to follow the procedure below for sharing a software license.



Sharing a license for Mastersizer 3000 users

In order to enable the use of the Mastersizer 3000 on a computer which is not connected to an instrument, it is necessary for users to create a license. This can then be shared with other users, allowing them to gain access to the software.

To share a license, follow the steps below:

- 1. At the computer that is connected to the instrument, run the Mastersizer 3000 software and click on the **Application Menu** icon at the top left of the screen.
- 2. Select **About** and click on the **View License...** button.
- 3. Click on the Share this License... button. The system tells you what information the license file contains.
- 4. To accept that information click Yes and choose a location to copy the file to (e.g. a memory stick).
- 5. At the separate computer, install the Mastersizer 3000 software and start the program. At the license screen, click the Install button.
- 6. Browse to the folder that contains the license file from step 4 above and select the license file. The licensee details will be shown, and you can now accept or decline the license.

Note: The software license is specific to a given Mastersizer 3000 system. When a license is shared, detailed user and computer information is stored in the license file, ensuring it can be traced back to its source Mastersizer 3000 system. Users should only share the license with users within their organizations who need to analyze data off-line. The software license must not be shared with other organizations without the consent of Malvern Panalytical.

Sharing a license for Mastersizer 3000E users

The Mastersizer 3000E system is provided with a simplified, basic version of the Mastersizer 3000 software. This basic software version is restricted to use on a single computer workstation attached to the Mastersizer 3000E system. As such, the license sharing facility offered for Mastersizer 3000 users is not available.

Users of the Mastersizer 3000E system who want to be able to use the software on multiple workstations will need to purchase a software upgrade. This upgrade will enable the premium features associated with the Mastersizer 3000 software, including the ability to create shared licenses. Please contact your local Malvern representative if you would like to purchase this upgrade.

Software guides

The Mastersizer 3000 software includes a comprehensive help system, which provides a functional description of each of the software elements. In addition to this, the software includes a series of 'MiniGuides', which provide an introduction to useful software tools and new features. These are accessed via the MiniGuides option on the Home ribbon bar:





New features and fixed issues

New feature(s)

Smart Instrument capability has been added as an additional Mastersizer 3000 software option. When enabled only instrument health telemetry data (non-proprietary customer information) will automatically be uploaded to the Malvern Panalytical cloud. The information provided will help us resolve your queries faster and allow us to continually improve the quality of our Mastersizer 3000 solution.

For more information visit:

https://www.malvernpanalytical.com/en/connected-world/smart-manager/index.html

Fixed issues

Reference(s)	Issue
177495	End users are now able to save measurement files when the "secure folder permissions" are activated.
168500	End user will only see the following warning messages when there is a genuine laser related issue i.e., "The laser power is low. The laser power is failing, or the laser shutter has a fault"
169937	The Hydro SV can now be removed from the optical bench to add sample and re-inserted into optical during a measurement workflow without issue.
165268	The has been a significant improvement in the time taken for some users to log onto the software whilst utilising the 21 CFR Part 11 aspect of the MS3000 software.

Security advisories

This software version does not contain any specific security updates since version 3.83. For 3.83 security updates please refer to SUN v3.83.

Note: We always recommend updating to the latest software version which will provide you with new features, bugfixes and most importantly, security updates.

Note: Other products may also be affected by any issue described here. We recommend you regularly check the Software Updates Notifications (SUNs) for all your Malvern Panalytical products and register on our website to receive updates.

File types and locations

The Mastersizer 3000 software uses a series of different file types to store data and measurement settings. These are described below, in order to help users who wish to secure the Mastersizer 3000/3000E system using the Microsoft Windows security and access settings. Guidance regarding how to set up the security settings is provided in the Windows Security Settings section of this document.

File Type	Extension	Default Path	Advised security setting for 21CFR Part 11 Mode
21CFR11 mode: Audit trails (Mastersizer 3000 only)	.mpaf	C:\ProgramData\Malvern Instruments\Mastersizer 3000\Audit Trails	Prevent deletion of the files in this directory. However, read, write, and modify access must be maintained.
User sizes	.siz	C:\ProgramData\Malvern Instruments\Mastersizer 3000\User Sizes	No control required as these settings are stored in SOPs.
User defined materials	.mmat	C:\ProgramData\Malvern Instruments\Mastersizer 3000\Materials	No control required as these settings are stored in SOPs.
User defined dispersants	.mdis	C:\ProgramData\Malvern Instruments\Mastersizer 3000\Dispersants	No control required as these settings are stored in SOPs.



Data quality add-ins (Mastersizer 3000 only)	.mdaq	Shared workspace: C:\ProgramData\Malvern Instruments\Mastersizer 3000\ Workspace\Data Quality Addins Private workspace: C:\Users\{user_name}\Documents\Malvern Instruments\Mastersizer 3000\Workspace\Data Quality Addins	No control required as the data quality tool only provides advice.
Export data	.txt.csv.rtf	Shared workspace: C:\ProgramData\Malvern Instruments\Mastersizer 3000\ Workspace\Export Data Private workspace: C:\Users\{user_name}\Documents\Malvern Instruments\Mastersizer 3000\Workspace\Export Data	If data export is a critical part of the SOP used for your samples, then you should prevent deletion of the files in this directory. However, read, write, and modify access must be maintained.
Measurement data	.mmes	Shared workspace: C:\ProgramData\Malvern Instruments\Mastersizer 3000\ Workspace\Measurement Data Private workspace: C:\Users\{user_name}\Documents\Malvern Instruments\Mastersizer 3000\Workspace\Measurement Data	Prevent deletion of the files in this directory. However, read, write, and modify access must be maintained.
Reports	.mrep	Shared workspace: C:\ProgramData\Malvern Instruments\Mastersizer 3000\ Workspace\Reports Private workspace: C:\Users\{user_name}\Documents\Malvern Instruments\Mastersizer 3000\Workspace\Reports	Prevent deletion of the files in this directory. However, read, write, and modify access must be maintained. Note: it is important that users are prevented from deleting reports via the software interface as well. This can be done using the MAC application.
SOP templates	.msot	Shared workspace: C:\ProgramData\Malvern Instruments\Mastersizer 3000\ Workspace\SOP Template Private workspace: C:\Users\{user_name}\Documents\MalvernInstruments\Mastersizer 3000\Workspace\SOP Template	No control required.
SOP	.msop	Shared workspace: C:\ProgramData\Malvern Instruments\Mastersizer 3000\ Workspace\SOP Private workspace: C:\Users\{user_name}\Documents\Malvern Instruments\Mastersizer 3000\Workspace\SOP	Prevent deletion of the files in this directory. However, read, write, and modify access must be maintained.
Data export templates	.mext	Shared workspace: C:\ProgramData\Malvern Instruments\Mastersizer 3000\ Workspace\Data Template Private workspace: C:\Users\{user_name}\Documents\Malvern Instruments\Mastersizer 3000\Workspace\Data Template	No control required.
Licence file	.licence	Mastersizer3000.licence file stored in: C:\ProgramData\Malvern Instruments\Mastersizer 3000\Configuration Files	Once the system has been set up and 21 CFR Part 11 mode engaged then access to this file must be set to prevent deletion. However, read, write, and modify access must be maintained.
Security configuration file	.xml	Exported from the Malvern Access Configurator (MAC) application. The directory is user-specified. Malvern advise that the file should be stored in: C:\ProgramData\Malvern Instruments\Mastersizer 3000\Configuration Files	Prevent deletion this file once it is created. However, read, write, and modify access must be maintained.
Various system wide configuration files	Various	C:\ProgramData\Malvern Instruments\Mastersizer 3000	Full access must be maintained to this directory for the program to function correctly.




Changing the destination path for a file

The following folders can be configured from within the Mastersizer 3000/3000E software:


- SOP
- Measurement Data
- Reports
- Export Data

For Mastersizer 3000 users and those who have upgraded the Mastersizer 3000E software, the default file location for these files can be configured via the Target Folders section of the Workspace viewer. To do this, click on the pencil icon which appears when you hover over the directory shortcut:



Changing the directory associated with this shortcut will change the default directory accessed by the Mastersizer 3000 software for the selected file type.

Configuration of the target directories can also be configured from the **User Preferences-Folders** section of the **Options** menu:



Again, hover over the shortcut and click on the pencil icon in order to change the target directory. Note that this is the only place in the software where the target directories can be configured when using the Basic software for the Mastersizer 3000E.



Backup and restore files

What to backup

By installation default, the Mastersizer 3000 application uses the *C:\ProgramData\Malvern Instruments\Mastersizer 3000* and its subfolders for configuration and user created output files. For ease, we would suggest this is the simplest folder to backup and restore.

To create a backup, we recommend that you consult your IT department to select the best method to achieve this. For pharmaceutical regulated environments, you should also consult your validation department, as they may have specific compliance requirements, and/or recommendations.

Restoring your files to the original PC hardware

If you have recovered your PC by having to re-install Windows®, you can simply restore your backup files to their original folder/s, then reinstall the Malvern Mastersizer application software.

Note: You must only install your original, or later version, as some files will not be backwards compatible.

Restoring your files to a new PC

Restore your backup files to their original folder/s, then delete the *C:\ProgramData\Malvern Instruments\Mastersizer 3000\Configuration Files\Mastersizer 3000.licence file*, before installing the Mastersizer 3000 application software.

For pharmaceutical customers using the 21CFR features, enter your 21CFR key and re-enable the desired 21CFR features.

Note

The C:\ProgramData\Malvern Instruments\Mastersizer 3000\Configuration Files\Mastersizer 3000.licence **file**, contains information taken from your old PC and may cause issues with the licencing of the application, if you do not delete this file before starting the application.

Smart Instrument

If you have an internet connection and have chosen to make your instrument a smart instrument during the Mastersizer 3000 software installation, your instrument will automatically start uploading key parameters to Malvern Panalytical.

You can check the status of your connection by locating the Malvern Panalytical Cloud Service application on the Windows taskbar - right-click the icon the Click Status.

If you did not allow the service to send data to Malvern Panalytical during the Mastersizer 3000 software installation, you can simply right-click the same application, then click Register.

Windows security settings

With a 21 CFR Part 11 compliant computer system, one of first concerns to address is the potential for the loss of data: either accidently, or by intention. Utilizing the built-in security tools of Microsoft Windows®, an IT professional can effortlessly change user access to specific files and/or folders by simply changing certain file/folder permissions.

For the next part of this document, it is assumed that you have the required administrator rights for the system upon which the Mastersizer software is being installed; allowing you to install, or update software and configure windows security permissions.

Note:

For the following demonstration we are going to use the **Users** group, a default group for most typical Windows installations.




CAUTION!

We strongly advise customers not to disable the Windows UAC feature, as this may allow users to delete files and/or folders, compromising audit history and/or measurement data critical to 21CFR compliance.




Changing the folder security permissions in Windows 10 & 11

1. Using Windows File Explorer, navigate to one of the folders that needs to be secured - in this case we have selected the folder where the Mastersizer audit trail files are stored. Right-click on the folder and through the context menu select **Properties** (1).




2. Within the Audit Trails Properties dialogue, left-click on the Security tab (2) and left-click the Advanced button (3) to open the Advanced Security Settings.



3. Within the Advanced Security Settings left-click the Disable inheritance button (4).





- 4. Within Block Inheritance, left-click on Convert inherited permissions into explicit permissions on this object (5), to remove the permission inheritance from the parent folder, whilst keeping any current users and groups settings.
- 5. After returning to the Advanced Security Settings window, remove any unwanted users and/or groups, leaving the System, Administrators and Users groups.




CAUTION!

If repurposing one of the **Users** groups, or an existing domain group, make sure that the group permissions apply to *this folder, subfolders, and files*.


Applies to: This folder, subfolders and files

- 6. Select the **User** group and left-click the edit button (6).
- 7. In the Permissions Entry window, left-click the Show advanced permissions (7) to reveal the full permissions list.





8. Left-click to de-select the check-boxes of Delete subfolder and files, Delete (8), Change permissions, Take ownership (9) and finish by left-clicking the OK button (10) to return you to the previous window.





- 9. Left-click to select the check-box for Replace all child permission entries with inheritable permission entries from the object (11) and left-click the Apply button (12).
- 10. Left-click the Yes button (13) when prompted to replace the permissions and the OK button (14) when you return to the previous window.






11. Left-click the OK button (15) when you return to original folder properties window.




Recommended PC power settings

- 1. The Mastersizer 3000 works best with High Performance power settings. The following information shows how to configure the power options for optimum performance. Launch the Control Panel app, then Hardware and Sound then Power Options.
- 2. From the list of Preferred Plans, choose High Performance.
- 3. Click on Change Plan Settings.



4. From the Edit Plan Settings window, click on Change advanced power settings.



- 5. From the Power Options window, set the following.
 - Hard Disk > Turn off hard disk after = Never
 - Sleep > Sleep after = Never
 - USB Settings > USB selective suspend setting = Disabled
 - PCI Express > Link State Power Management = Off
 - Processor power management > Minimum processor state = 100%
- 6. Click the Apply button followed by the OK button.
- 7. From the Edit Plan Settings widow, click the Save Changes button (some versions of Windows do not make this button available, just close the window).




- 8. Return to the Control Panel home page and click the Device Manger.
- 9. From the Device Manager window, scroll down and click the twister adjacent to Universal Serial Bus controllers to expand the view.
- 10. Double click each listed device and look for a tab named Power Management.
- 11. Uncheck the Allow the computer to turn off this device to save power and click the OK button.
- 12. Repeat for all USB devices (some versions of Windows may not have the Power Management option).

Upgrading from an earlier version of software

Measurement file format

In v3.40 of the Mastersizer 3000 software we have re-introduced the file format used in older versions of the software (v3.10 and earlier) due to an incompatibility issue we discovered when the software's 21 CFR Part 11 features are enabled. This format is now selected by default and offers the advantage that it is compatible with all earlier versions of the software.

Note that files created using v3.20 and v3.30 of the Mastersizer 3000 software can still be opened, edited, and saved using v3.40. The software will automatically switch to the correct file format if you select a file created in these versions. If you want to specifically create a file in the same format used by v3.20 and v3.30, select the Measurement file (special compatibility) option when creating a new measurement file:




Audit trail upgrade

Versions 3.70 and later use a different auditing file format designed to improve the security of the audit trail.

Upgrading to v3.72 or later (including this version), from v3.63 or earlier, will cause an audit trail conversion and checking process to occur when the software is first initiated. A series of messages will be displayed like the example below:




Once complete, the following message will be displayed.




If you are upgrading from Mastersizer 3000 software v3.70 to v3.72 the message below will be displayed, indicating that an audit trail format update is being applied to fix bug issue #91576:





However, if you are using v3.72 and have experienced the bug issue #91576, a different message will be displayed, and the audit trail will be labelled 'quarantined':



Please contact for local Malvern Panalytical representative If this message appears.

Measurement file size and corruption warnings

Version 3.20 and higher of the Mastersizer software includes the ability to detect when measurement files are at risk of becoming corrupted. If you see one of these messages, you are probably creating too large a measurement file. We recommend that you keep measurement files to a maximum size of 100 records and advise that you try to remember to regularly create and use new files to store measurement records.

Note that Malvern Panalytical are currently investigating possible alternative measurement file formats for use in future software releases, with the goal of increasing the maximum number of records which can be robustly stored within a single file.

Backward compatibility with Mastersizer 2000

This software is only compatible with the Mastersizer 3000 (MAZ3000) and Mastersizer 3000E (MAZ3010) systems and cannot be used with the Mastersizer 2000 (APA2000) or Mastersizer 2000E systems. It is possible, however, to review Mastersizer 2000 / 2000E results within the Mastersizer 3000 / 3000E software. Please refer to the user manuals and software help for guidance as to how this is achieved.

Known issues


The following software bugs have been discovered within the software and will be investigated as part of a future release. Please follow the suggested work-around for each issue when operating the software.



Manual measurement settings do not match the connected / active dispersion unit

Occasionally, users may see the wet accessory related manual measurement settings when a dry unit is attached, or visa-versa. If this occurs, open the manual measurement settings window and click the New menu item from the window Features menu:

This will reset all measurement settings to their defaults for the active accessory type. This issue has been reported after upgrading from early versions of the software but does not occur on all systems.



Issue	Work Around / Details	Comment
PV certificate may not be generated when clock time format in Windows was set to Short time (HH:MM).	To resolve ensure that Windows OS clock time format is set to Long time (HH:MM:SS).	Intermittent Observation. Resolution available – see details.
During SOP measurements there have been occasions where records have been skipped, e.g., 3 runs requested and records 1, 4, 5 generated in measurement file.	Intermittent observation no current workaround available.	Intermittent Observation.
Accessory status bar is green but SOP and Manual measurement options greyed out.	From time to time the SOP and manual measurement options are still greyed out even when the accessory status bar is green. To re-enable these options, right-click on the accessory status bar and reselect the accessory.	Intermittent Observation. Work around procedure available.
Downgrading this version of the software to v3.81 or below will mean that the software will not function, as v3.82 introduced updated Windows Drivers. These drivers are not compatible with versions of the Mastersizer 3000 software prior to v3.82.	We advise contacting your Malvern Panalytical representative for support to ensure the correct procedure is followed.	High risk issue. Work around procedure available.
"% sample integration actually completed" message intermittently observed in place of "The lid must be closed" Aero message when the Aero lid is opened between analysis of multiple dry samples in SOP mode.	No work around available. Press Initialise Instrument button and continue with analysis.	Intermittent Observation.
Reporting of zero measurements.	In rare cases a zero measurement can occur in both wet and dry measurements. The measurement record contains background and data but no signal information. A zero distribution is recorded in the measurement file. No work-around available.	Medium risk issue.



Software can crash when batch printing	When selecting too many reports and/or too many records for batch printing, an error can occur causing a crash exception. Restricting the total number of pages printed to 220 or less (equivalent to 13 results batch printed with 10 reports) will mitigate this issue occurring	Low risk issue.
Aero S and Aero M sample feed control	When carrying out manual measurements it is possible to enable the sample feed for the Aero dispersion unit with the vacuum and dispersion air switched off by clicking the Feed button twice within the accessory controls. After approximately ten seconds the system will switch back into standby mode and an 'insufficient exhaust vacuum / air achieved' error message will be displayed. However, some sample may be lost. Error can be avoided procedurally by not double-clicking the feed button).	Low risk issue. Work around procedure available.
Corrupt report settings file causes software crash on start-up	It has been observed that the global report settings file may become corrupt. This file holds the company name and logo used across all reports in the software. A symptom of this issue is the software crashing on start-up with an exception "hexadecimal value 0x00, is an invalid character". The workaround is to delete the contents of folder at C:\ProgramData\Malvern Instruments \Malvern.Reporting. This will trigger a new fresh settings file to be created – you will have to reconfigure your company name and logo in reports.	Medium risk issue.
Warnings are displayed about corrupt measurement files	The software has built in detection of when measurement files are at risk of being corrupted. If you see one of these messages, you are probably creating too large a measurement file.	Intermittent Observation.
Instrument disconnects after firmware upgrade	An issue has been seen for some installations whereby the instrument will become disconnected from the computer following a firmware upgrade. Turning the instrument off and on again will cause it to successfully reconnect to the software.	Intermittent Observation.
Some bespoke custom macros / calculations my not run.	Please contact your local Malvern Panalytical representative.	Low risk issue. Work around procedure available.
Some text still appears in English when running with a different language selected.	The translation of all software text will continue in future releases.	Low risk issue.
Software does not open all files selected when they are opened using Windows Explorer.	Use the Open menu option in the Mastersizer 3000 software to open multiple files.	Low risk issue. Work around procedure available.
The system audit trail displays duplicated columns for each language under which the system has been run when auditing has been enabled.	No work-around available.	Low risk issue.
Various fields in the Edit result window lose their 'edited' blue background appearance when a different page in the editor is selected.	No work-around available. This is a display issue only, as the software correctly applies the edit values when the OK button is pressed.	Low risk issue.
Trend table print out is limited by paper size	Report widgets are designed to fit on one page and will not wrap over pages. If you select lots of measurement records, the trend table widget will expand to fill the page. However, if you select more measurement records than can fit in a trend table on a single page then the displayed records will be truncated at the page boundary. The only work around for this issue is to print the report on a larger paper size. Paper size A4 has a limit of 56 records in a trend table, whereas paper size A3 has a limit of 86 records.	Low risk issue.



Some parameters are not imported from Mastersizer 2000 measurement records	When importing Mastersizer 2000 measurement records into the Mastersizer 3000 software, some SOP parameters from the Mastersizer 2000 records do not get imported. However, all of the parameters required for result review or recalculation are present.	Low risk issue.
Manual measurement errors are reported if the Aero dispersion unit configuration has changed between measurements	The manual measurement feature in the software stores the last used settings. This includes configuration of the Aero dry powder disperser. If you change the configuration between measurements and then open a manual measurement, the software will report an error stating that configuration is wrong. If this happens, close and reopen the manual measurement window and change the manual measurement settings to match your new Aero configuration.	Low risk issue.
Software exception is reported if the software is closed when a macro is running	All currently running macros must be closed before closing the software.	Low risk issue. Work around procedure available.
Some report widgets are truncated in the print preview view	Some report widgets may not be displayed correctly within the print preview screen. However, if the report is printed all of the information within the widget will be shown.	Low risk issue.
Software may crash when exporting data with custom sample identifiers which start with a number	Exporting measurement data with custom sample identifiers beginning with a number will cause the software to crash when you select an export template that contains sample identifiers. The only work- around is to prefix sample identifiers with letters.	Low risk issue. Work around procedure available.
Ultrasound SOP option 'Continuous (From Measurement Start)' does not turn off in SOP playlist	If you use an SOP with the ultrasound option 'Continuous (From Measurement Start)' in an SOP playlist, when running a subsequent SOP with no ultrasound turned on, the ultrasound will not turn off as expected. The work around is to use the 'Continuous (From Sample Addition)' option in the SOP rather than 'Continuous (From Measurement Start)'. When this playlist is run, then the ultrasound will turn off when executing a subsequent SOP which does not require ultrasound.	Low risk issue. Work around procedure available.
Cannot load old custom calculations from file	When trying to load a custom calculation created in v3.30 software or earlier, the software may report error and the calculation will not load. The workaround is to re-export the custom calculation from the original report in a recent version of the software.	Low risk issue. Work around procedure available.
Data quality tab is not displayed immediately when selected from the extended features list	Given that the software has just been installed and the option to enable the extended software features is selected. Then when the application is restarted the data quality tab will not be displayed if the default view is selected. The work-around is to select the 2-pane vertical view which will display the data quality tab. Then reverting to the default view will display the data quality tab.	Low risk issue. Work around procedure available.
Ultrasound level applied during clean reported as 0%	You may find that the measurement manager reports that 0% ultrasound is being applied during cleaning when you have set an ultrasound demand of greater than 0%. Evidence suggests that ultrasound is applied correctly as per the configured ultrasound demand, but the value shown in the measurement window is incorrect.	Low risk issue.



This is a false-positive error message, a consequence of a design records created in y3.30 or earlier attempting to resign records created in y3.30 or earlier attempting to resign records created in y3.30 or earlier versions of the software (y3.30 and earlier), duplicate parameters to be disregarded. However, this means that when a measurement is created in v3.30 or earlier, and then signed in a later version of the software can cause this functionality to be switched off. Downgrading with 21CFR11 mode enabled to earlier version of the software can cause this functionality to be switched off. On repeated running of a dry SOP incorrect warning messages can be displayed if the lid is left open when adding more sample. Close the SOP at the end of each sample measurement and ending more sample. Change accessory and then re-launch the application software working to an alternative wet accessory, the ultrasound settings may not be applied correctivy. The SOP history report only contains audit trail information is blank for previous versions. The parameter 'Ultrasound Achieved' is always report as zero for pre-measurement ultrasound and an automated wet dispersion unit and son the resolution will be software to cream and so prevention in the number of the software to cream and so prevention in the number of the software and an automated wet dispersion unit and nan automated wet dispersion unit and son the number of the street stops at the "Add sample stage" and does not re-start the software, and retry the Optical Property Optimizer can cause the obscuration limit is exceeded The text and table does not clear completely when records are de-selected, the results from the last record that rejected if the upper obscuration limit has been exceeded. The parameter 'Ultrasound bemand' is reported correctly completed in the software to cream in Splayed in the table. For each record, the obscuration can be compared to the obscuration limit post measurement and the record data rejected if the upper obscuration limit ha			
version of the software can cause this functionality to be switched off. Or repeated running of a dry SOP incorrect warning messages can be displayed if the lid is left open when adding more sample measurement and adding more sample measurement and adding more sample adding so she software transports and the last more adding so she software to crash adding so she same sample details and the subsequent sample is analyzed using the same sample details and the subsequent sample is analyzed using the same sample details and the software invalid and invalid values are entered in SOP settings of the software invalid values are entered in SOP settings and then relaunch the application software. Close the SOP at the end of each sample measurement and restart the SOP work around procedure available. Low risk issue. Low risk issue. Work around procedure available. Intermittent observation. Work around procedure a		design issue fix implemented in v3.40 onwards. In earlier versions of the software (v3.30 and earlier), duplicate parameters were written to the measurement record. From v3.40 onwards, a fix was applied which enabled the duplicate parameters to be disregarded. However, this means that when a measurement is created in v3.30 or earlier, and then signed in a later version of the software, the signature information is written over the top of the duplicate data, causing the false-positive error	The error message is a false-positive (data is not missing) and locking signatures are not lost on v3.81, so it is unlikely a user will need to resign a
messages can be displayed if the lid is left open when adding more sample After switching to an alternative wet accessory, the ultrasound settings may not be applied correctly The SOP history report only contains audit trail information is blank for previous versions The parameter 'Ultrasound Achieved' is always report as zero for pre-measurement ultrasound Opening the Optical Property Optimizer can cause the software to crash After switching between a manual wet dispersion unit and an automated wet dispersion unit then running an SOP the stirrer stops at the "Add sample stage" and does not re-start. In a wet measurement an SOP can continue if the upper obscuration limit is exceeded The trend table does not clear completely when records are de-selected, the results from the last record to be de-selected remain displayed in the table to be de-selected remain displayed in the table to be de-selected remain displayed in the table loss played when invalid values are entered in SOP settings Intermittent failure of pre-measurement ultrasound Intermittent failure of pre-measurement ultrasound procedure available. Charges made to the SOP settings can be highlighted in the SOP history view. Work around procedure available. Intermittent observation. Work around procedure available. Intermittent observation. Work around procedure available. Low risk issue. Low risk issue. Work around procedure available. Low risk issue. Work around procedure available. Low risk issue. Work around procedure available. Intermittent observation. Work around procedure available. Low risk issue. Low risk issue. Close and restart the SOP table the end of the measurement, new sample details can then be entered Intermittent failure of pre-measurement ultrasound lintermittently the ultrasound does not turn on during the pre-measurement ultrasound does not turn on during the pre-measurement ultrasound phase. The timer counts Intermittent failure of pre-measurement ultrasound loss on the time counts Intermittent failure	version of the software can cause this functionality to		
Ultrasound settings may not be applied correctly The SOP history report only contains audit trail information for the last modification. The audit trail information for the last modification. The audit trail information is blank for previous versions The parameter /Ultrasound Achieved' is always report as zero for pre-measurement ultrasound Opening the Optical Property Optimizer can cause the software to crash This generally occurs with a fresh software installation, restart the software, and retry the Optical Property Optimizer After switching between a manual wet dispersion unit and automated wet dispersion unit then running an SOP the stirrer stops at the "Add sample stage" and does not re-start. In a wet measurement an SOP can continue if the upper obscuration limit is exceeded For each record, the obscuration can be compared to the obscuration limit has been exceeded. For each record, the obscuration limit has been exceeded. No work-around available Low risk issue. Work around procedure available. Intermittent observation. Work around procedure available. Intermittent observation. Intermittent observation. Work around procedure available. Intermittent observation. Intermit	messages can be displayed if the lid is left open when	•	
information for the last modification. The audit trail information is blank for previous versions The parameter 'Ultrasound Achieved' is always report as zero for pre-measurement ultrasound Opening the Optical Property Optimizer can cause the software to crash Opening the Optical Property Optimizer can cause the software to crash After switching between a manual wet dispersion unit and an automated wet dispersion unit then running an SOP the stirrer stops at the "Add sample stage" and does not re-start. In a wet measurement an SOP can continue if the upper obscuration limit is exceeded The trend table does not clear completely when records are de-selected, the results from the last record to be de-selected remain displayed in the table The Optical Property Optimizer view can be blank when accessed for the first time On repeating an SOP, it does not ask for new sample details and the subsequent sample is analyzed using the same sample details and the subsequent sample is analyzed using the same sample details Intermittent failure of pre-measurement ultrasound during SOPs The parameter 'Ultrasound Demand' is reported correctly Low risk issue. Work around procedure available. Intermittent observation. Work around procedure available. Usw risk issue. Work around procedure available. Low risk issue. Intermittent observation. Work around procedure available. Low risk issue. Close and restart the Optical Property Optimizer Low risk issue. Low risk issue. Low risk issue. Intermittent failure of pre-measurement ultrasound during SOPs Intermittent failure of pre-measurement ultrasound phase. The timer counts Intermittent failure of pre-measurement ultrasound phase. The timer counts			
After switching between a manual wet dispersion unit and an automated wet dispersion unit and an automated wet dispersion unit the running an SOP the stirrer stops at the "Add sample stage" and does not re-start. In a wet measurement an SOP can continue if the upper obscuration limit is exceeded The trend table does not clear completely when records are de-selected, the results from the last record to be de-selected remain displayed in the table The Optical Property Optimizer view can be blank when accessed for the first time On repeating an SOP, it does not ask for new sample details and the subsequent sample is analyzed using the same sample details Incorrect warnings (in hover over tool tips) can be displayed when invalid values are entered in SOP settings Intermittent failure of pre-measurement ultrasound during SOPs The intermittent failure of pre-measurement ultrasound during SOPs This generally occurs with a fresh software installation, restart the Optical Property Optimizer with a fresh software installation, restart the Optical Property Optimizer and restart the software, and retry the Optical Property Optimizer Low risk issue. Intermittent observation. Work around procedure available. Work around procedure available. Work around procedure available. Work around procedure available. Low risk issue. Close and restart the Optical Property Optimizer Low risk issue. Low risk issue. Low risk issue.	information for the last modification. The audit trail	5 5 5	
restart the software, and retry the Optical Property Optimizer After switching between a manual wet dispersion unit and an automated wet dispersion unit then running an SOP the stirrer stops at the "Add sample stage" and does not re-start. In a wet measurement an SOP can continue if the upper obscuration limit is exceeded The trend table does not clear completely when records are de-selected, the results from the last record to be de-selected remain displayed in the table The Optical Property Optimizer view can be blank when accessed for the first time On repeating an SOP, it does not ask for new sample details and the subsequent sample is analyzed using the same sample details Incorrect warnings (in hover over tool tips) can be displayed when invalid values are entered in SOP settings Intermittent failure of pre-measurement ultrasound during SOPs The trend table does not clear completely when records are de-selected, the results from the last record to be de-selected remain displayed in the table For each record, the obscuration can be compared to the obscuration limits post measurement and the record data rejected if the upper obscuration limit has been exceeded. Work around procedure available. Work around procedure available. Work around procedure available. Uow risk issue. Clow risk issue. Close and restart the SOP at the end of the measurement, new sample details can then be entered Intermittently the ultrasound does not turn on during the pre-measurement ultrasound phase. The timer counts If this error is observed, please contact your local Malvern Panalytical		The parameter 'Ultrasound Demand' is reported correctly	Low risk issue.
the application software. Work around procedure available. For each record, the obscuration can be compared to the obscuration limit is exceeded. For each record, the obscuration can be compared to the obscuration limit has been exceeded. Work around procedure available.		restart the software, and retry the Optical Property	Intermittent observation.
obscuration limit is exceeded obscuration limits post measurement and the record data rejected if the upper obscuration limit has been exceeded. The trend table does not clear completely when records are de-selected, the results from the last record to be de-selected remain displayed in the table The Optical Property Optimizer view can be blank when accessed for the first time On repeating an SOP, it does not ask for new sample details and the subsequent sample is analyzed using the same sample details Incorrect warnings (in hover over tool tips) can be displayed when invalid values are entered in SOP settings Intermittent failure of pre-measurement ultrasound during SOPs Obscuration limits post measurement and the record data rejected if the upper obscuration limit has been exceeded. Work around procedure available. Low risk issue. Close and restart the Optical Property Optimizer Low risk issue. Low risk issue. Intermittently the ultrasound does not turn on during the pre-measurement ultrasound phase. The timer counts If this error is observed, please contact your local Malvern Panalytical	and an automated wet dispersion unit then running an SOP the stirrer stops at the "Add sample stage" and	•	
records are de-selected, the results from the last record to be de-selected remain displayed in the table The Optical Property Optimizer view can be blank when accessed for the first time On repeating an SOP, it does not ask for new sample details and the subsequent sample is analyzed using the same sample details Incorrect warnings (in hover over tool tips) can be displayed when invalid values are entered in SOP settings Intermittent failure of pre-measurement ultrasound during SOPs Restart the Optical Property Optimizer Close and restart the SOP at the end of the measurement, new sample details can then be entered No work-around available Low risk issue. Intermittent failure of pre-measurement ultrasound does not turn on during the pre-measurement ultrasound phase. The timer counts		obscuration limits post measurement and the record data	
accessed for the first time On repeating an SOP, it does not ask for new sample details and the subsequent sample is analyzed using the same sample details Incorrect warnings (in hover over tool tips) can be displayed when invalid values are entered in SOP settings Intermittent failure of pre-measurement ultrasound during SOPs Close and restart the SOP at the end of the measurement, new sample details can then be entered Low risk issue. Low risk issue. Intermittent failure of pre-measurement ultrasound does not turn on during the pre-measurement ultrasound phase. The timer counts If this error is observed, please contact your local Malvern Panalytical	records are de-selected, the results from the last record	No work-around available	Low risk issue.
details and the subsequent sample is analyzed using the same sample details Incorrect warnings (in hover over tool tips) can be displayed when invalid values are entered in SOP settings Intermittent failure of pre-measurement ultrasound during SOPs Intermittent failure of pre-measurement ultrasound during SOPs Intermittent failure of pre-measurement ultrasound phase. The timer counts Intermittent failure of pre-measurement ultrasound does not turn on during the pre-measurement ultrasound phase. The timer counts		Restart the Optical Property Optimizer	Low risk issue.
displayed when invalid values are entered in SOP settings Intermittent failure of pre-measurement ultrasound during SOPs Intermittent failure of pre-measurement ultrasound during SOPs Intermittently the ultrasound does not turn on during the pre-measurement ultrasound phase. The timer counts your local Malvern Panalytical	details and the subsequent sample is analyzed using		Low risk issue.
during SOPs pre-measurement ultrasound phase. The timer counts your local Malvern Panalytical	displayed when invalid values are entered in SOP	No work-around available	Low risk issue.
down, but the ultrasound does not turn on.	·		



Service & Support

Malvern Panalytical provides the global training, service and support you need to continuously drive your analytical processes at the highest level. We help you increase the return on your investment with us and ensure that as your laboratory and analytical needs grow, we are there to support you. Our worldwide team of specialists adds value to your business processes by ensuring applications expertise, rapid response, and maximum instrument uptime.

- Local and remote support.
- Full and flexible range of support agreements.
- Compliance and validation support.
- Onsite or classroom-based training courses.
- e-Learning training courses and web seminars.
- Sample and application consultancy.

Remote support

Malvern Panalytical offers remote support over a secure internet connection. This is typically the most convenient way to for our customers to get help with their applications and technical support needs. For remote support over the Internet, we recommend TeamViewer, WebEx, or Microsoft Teams - but we are also happy to accommodate other technologies our customers may prefer.

Installation questions & support

For contact information for your local office, please visit:

https://www.malvernpanalytical.com/en/about-us/contact-us/

https://www.malvernpanalytical.com/en/support/contact-support/support.html



Malvern Panalytical

Grovewood Road, Malvern, Worcestershire, WR14 1XZ, United Kingdom Lelyweg 1, 7602 EA Almelo, The Netherlands

Tel: +44 1684 892456 Fax: +44 1684 892789 Tel: +31 546 534 444 Fax: +31 546 534 598

info@malvernpanalytical.com www.malvernpanalytical.com

Disclaimer: Although diligent care has been used to ensure that the information in this material is accurate, nothing herein can be construed to imply any representation or warranty as to the accuracy, correctness or completeness of this information and we shall not be liable for errors contained herein or for damages in connection with the use of this material. Malvern Panalytical reserves the right to change the content in this material at any time without notice. Copyright: © 2022 Malvern Panalytical. This publication or any portion thereof may not be copied or transmitted without our express written permission.

